



SAFETY DATA SHEET BOSTIK NE486

1 IDENTIFICATION OF THE SUBSTANCE/PREPARATION AND OF THE COMPANY/UNDERTAKING

PRODUCT NAME BOSTIK NE486
 PRODUCT NO. 02869, 95407
 SUPPLIER BOSTIK LIMITED
 COMMON ROAD
 STAFFORD
 STAFFORDSHIRE
 ST16 3EH
 +44 1785 255141
 +44 1785 272650 (24 HOUR)
 sds.uk@bostik.com

2 HAZARDS IDENTIFICATION

Highly flammable. Vapours may cause drowsiness and dizziness. Irritating to eyes and skin. Possible risk of harm to the unborn child.
 Harmful: danger of serious damage to health by prolonged exposure through inhalation. Toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment.

Pilot lights can ignite the vapour

CLASSIFICATION Xn;R48/20. Rep 3;R63. Xi;R36/38. F;R11. N;R51/53. R67.

PHYSICAL AND CHEMICAL HAZARDS

Vapours are heavier than air and may travel along the floor and in the bottom of containers. Vapours may be ignited by a spark, a hot surface or an ember.

3 COMPOSITION/INFORMATION ON INGREDIENTS

Name	EC No.	CAS-No.	Content	Classification
ACETONE	200-662-2	67-64-1	5-10%	F;R11 Xi;R36 R66 R67
BUTANONE	201-159-0	78-93-3	10-30%	F;R11 Xi;R36 R66 R67
CYCLOPENTANE	206-016-6	287-92-3	1-5%	F;R11 R52/53
HEPTANE AND ISOMERS			10-30%	Xn;R65. Xi;R38. F;R11. N;R50/53. R67.
HEXANE, MIXTURE OF ISOMERS			5-10%	Xn;R65. Xi;R38. F;R11. N;R51/53. R67.
MALEIC ANHYDRIDE	203-571-6	108-31-6	< 1%	C;R34 Xn;R22 R42/43
METHYLCYCLOHEXANE	203-624-3	108-87-2	1-5%	F;R11 Xn;R65 Xi;R38 R67 N;R51/53
N-HEXANE	203-777-6	110-54-3	< 1%	F;R11 Repr3;R62 Xn;R65,R48/20 Xi;R38 R67 N;R51/53
PENTANE	203-692-4	109-66-0	< 1%	F+;R12 Xn;R65 R66 R67 N;R51/53
ROSIN	232-475-7	8050-09-7	< 1%	R43
TOLUENE	203-625-9	108-88-3	10-30%	F;R11 Repr. Cat. 3;R63 Xn;R48/20,R65 Xi;R38 R67
ZINC OXIDE	215-222-5	1314-13-2	< 1%	N;R50/53

The Full Text for all R-Phrases are Displayed in Section 16

4 FIRST-AID MEASURES

BOSTIK NE486

GENERAL INFORMATION

CAUTION! First aid personnel must be aware of own risk during rescue! Remove victim immediately from source of exposure.

NOTES TO THE PHYSICIAN

No recommendation given, but first aid may still be required in case of accidental exposure, inhalation or ingestion of this chemical. If in doubt, GET MEDICAL ATTENTION PROMPTLY!

INHALATION

Move into fresh air and keep at rest. Be aware that symptoms of chemical pneumonia (shortness of breath) may occur several hours after exposure.

INGESTION

Get medical attention immediately! DO NOT induce vomiting if swallowed chemical is dissolved in petroleum-based material. Danger of aspiration and development of chemical pneumonia.

SKIN CONTACT

Wash off promptly and flush contaminated skin with water. Promptly remove clothing if soaked through and flush skin with water. If adhesive bonds skin, flush with water and seek medical assistance. Do not attempt to force skin apart if bonded. Continue to rinse for at least 15 minutes. Get medical attention if any discomfort continues.

EYE CONTACT

Immediately flush with plenty of water or eyewash solution for up to 10 minutes. Immediately transport to hospital or eye specialist.

5 FIRE-FIGHTING MEASURES

EXTINGUISHING MEDIA

Extinguish with foam, carbon dioxide, dry powder or water fog. Do not use water as an extinguisher.

SPECIAL FIRE FIGHTING PROCEDURES

Avoid breathing fire vapours. Keep up-wind to avoid fumes. Fight advanced or massive fires from safe distance or protected location. Be aware of danger of explosion. Keep run-off water out of sewers and water sources. Dike for water control.

UNUSUAL FIRE & EXPLOSION HAZARDS

HIGHLY FLAMMABLE! May explode when heated or when exposed to flames or sparks. Vapours are heavier than air and may spread near ground to sources of ignition. May travel considerable distance to source of ignition and flash back. Fire causes formation of toxic gases. Vapours may give explosive mixture with air at temperatures below normal room temperature.

SPECIFIC HAZARDS

By heating and fire, harmful vapours/gases may be formed.

PROTECTIVE MEASURES IN FIRE

Self contained breathing apparatus and full protective clothing must be worn in case of fire.

6 ACCIDENTAL RELEASE MEASURES

PERSONAL PRECAUTIONS

Wear protective clothing as described in Section 8 of this safety data sheet. Eye contact MUST be prevented by means of suitable personal protection equipment. Take precautionary measures against static discharges. Do not smoke, use naked flames or other sources of ignition. Avoid inhalation of dust and vapours. Provide adequate ventilation. In case of spills, beware of slippery floors and surfaces. Wear self contained breathing apparatus.

ENVIRONMENTAL PRECAUTIONS

Do not allow ANY environmental contamination. Contain spillages with sand, earth or any suitable adsorbent material. Do not discharge into drains, water courses or onto the ground.

SPILL CLEAN UP METHODS

Wear necessary protective equipment. Clean-up personnel should use respiratory and/or liquid contact protection. Wash thoroughly after dealing with a spillage. Stop leak if possible without risk. DO NOT touch spilled material! Extinguish all ignition sources. Avoid sparks, flames, heat and smoking. Ventilate. Ensure that waste and contaminated materials are collected and removed from the work area as soon as possible in a suitably labelled container. Ventilate well, stop flow of gas or liquid if possible. Remove ignition sources. Do not allow chemical to enter confined spaces such as sewers due to explosion risk. Sewers designed to preclude formation of explosive concentrations of vapour may be permitted.

7 HANDLING AND STORAGE

USAGE PRECAUTIONS

Do not handle broken packages without protective equipment. Avoid contact with eyes. Keep away from heat, sparks and open flame. Eliminate all sources of ignition. Risk of vapour concentration on the floor and in low-lying areas. Use explosion proof electric equipment. Contaminated rags and cloths must be put in fireproof containers for disposal. Do not eat, drink or smoke when using the product. Ventilate well, avoid breathing vapours. Use approved respirator if air contamination is above accepted level.

BOSTIK NE486

STORAGE PRECAUTIONS

Keep away from heat, sparks and open flame. Keep upright. Take precautionary measures against static discharges. Store in tightly closed original container in a dry and cool place.

STORAGE CLASS

Flammable liquid storage.


8 EXPOSURE CONTROLS/PERSONAL PROTECTION

Name	Std	LT - ppm	LT - mg/m3	ST - ppm	ST - mg/m3
ACETONE	WEL	500 ppm	1210 mg/m3	1500 ppm	3620 mg/m3
BUTANONE	WEL	200 ppm(Sk)	600 mg/m3(Sk)	300 ppm(Sk)	899 mg/m3(Sk)
MALEIC ANHYDRIDE	WEL		1 mg/m3(Sen)		3 mg/m3(Sen)
N-HEXANE	WEL	20 ppm	72 mg/m3		
PENTANE	WEL	600 ppm	1800 mg/m3		
TOLUENE	WEL	50 ppm(Sk)	191 mg/m3(Sk)	100 ppm(Sk)	384 mg/m3(Sk)

INGREDIENT COMMENTS

WEL = Workplace Exposure Limits

PROTECTIVE EQUIPMENT

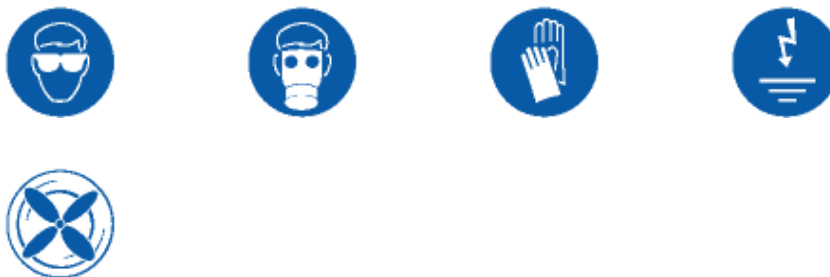

PROCESS CONDITIONS

Use engineering controls to reduce air contamination to permissible exposure level.

ENGINEERING MEASURES

Provide adequate ventilation, including appropriate local extraction, to ensure that the defined workplace exposure limit is not exceeded.

RESPIRATORY EQUIPMENT

If ventilation is insufficient, suitable respiratory protection must be provided. Check that mask fits tight and change filter regularly. Chemical respirator with organic vapour cartridge.

HAND PROTECTION

Barrier cream applied before work may make it easier to clean the skin after exposure, but does not prevent absorption through the skin. Protective gloves should be used if there is a risk of direct contact or splash. Viton rubber (fluor rubber).

EYE PROTECTION

Wear splash-proof eye goggles to prevent any possibility of eye contact.

OTHER PROTECTION

Wear appropriate clothing to prevent any possibility of liquid contact and repeated or prolonged vapour contact.

HYGIENE MEASURES

Wash at the end of each work shift and before eating, smoking and using the toilet. Use appropriate skin cream to prevent drying of skin.

SKIN PROTECTION

Wear apron or protective clothing in case of splashes.

9 PHYSICAL AND CHEMICAL PROPERTIES

APPEARANCE

Light viscous liquid

REVISION DATE: 18/03/2008

SDS NO.: 13291

BOSTIK NE486

COLOUR	Amber		
ODOUR	Solvent.		
SOLUBILITY	Immiscible with water		
RELATIVE DENSITY	0.85	VISCOSITY	2250 - 2750 mPas
FLASH POINT (°C)	- 25		

10 STABILITY AND REACTIVITY

STABILITY

Avoid: Contact with acids. Contact with peroxides. Contact with alkalis. Contact with combustibles. Stable under normal temperature conditions and recommended use.

CONDITIONS TO AVOID

Avoid heat, flames and other sources of ignition.

HAZARDOUS DECOMPOSITION PRODUCTS

By fire, toxic gases (CO, CO₂, NO_x) may be formed.

11 TOXICOLOGICAL INFORMATION

GENERAL INFORMATION

Known or suspected teratogen.

INHALATION

Vapour may irritate respiratory system or lungs. May cause nausea and vomiting. Anaesthetic in high concentrations. Unconsciousness, possibly death.

INGESTION

Ingestion of material may cause nausea and vomiting

SKIN CONTACT

May be absorbed through the skin. Product has a defatting effect on skin. Prolonged contact may cause dryness of the skin.

EYE CONTACT

May cause severe irritation to eyes. Contact with the eyes may cause physical damage

ROUTE OF ENTRY

Inhalation. Skin absorption. Ingestion. Skin and/or eye contact.

MEDICAL SYMPTOMS

High concentrations of vapours may irritate respiratory system and lead to headache, fatigue, nausea and vomiting.

MEDICAL CONSIDERATIONS

Chronic respiratory and obstructive airway diseases. Skin disorders and allergies. History of smoking.

12 ECOLOGICAL INFORMATION

ECOTOXICITY

Dangerous for the environment: May cause long-term adverse effects in the aquatic environment.

13 DISPOSAL CONSIDERATIONS

GENERAL INFORMATION

This material is classified as special waste as defined by Special Waste Regulations 1996 and must be disposed of by an authorised contractor

WASTE CLASS

Classified as Special Waste. Not permitted for landfill in liquid state.

14 TRANSPORT INFORMATION

BOSTIK NE486



UK ROAD CLASS	3		
PROPER SHIPPING NAME	ADHESIVES		
UN NO. ROAD	1133	UK ROAD PACK GR.	III
ADR CLASS NO.	3	ADR CLASS	Class 3: Flammable liquids.
ADR PACK GROUP	III	HAZARD No. (ADR)	30
ADR LABEL NO.	3	HAZCHEM CODE	3Y
CEFIC TEC(R) NO.	30GF1-III, 30GF1-sp	RID CLASS NO.	3
RID PACK GROUP	III	UN NO. SEA	1133
IMDG CLASS	3	IMDG PAGE NO.	3
IMDG PACK GR.	III	EMS	F-E, S-D
MARINE POLLUTANT	No.	UN NO. AIR	1133
AIR CLASS	3	AIR PACK GR.	III

15 REGULATORY INFORMATION

LABELLING



Harmful



Highly Flammable



Dangerous for the environment

CONTAINS

TOLUENE

RISK PHRASES

R11	Highly flammable.
R36/38	Irritating to eyes and skin.
R48/20	Harmful: danger of serious damage to health by prolonged exposure through inhalation.
R51/53	Toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment.
R63	Possible risk of harm to the unborn child.
R67	Vapours may cause drowsiness and dizziness.

SAFETY PHRASES

S9	Keep container in a well-ventilated place.
S13	Keep away from food, drink and animal feeding stuffs.
S16	Keep away from sources of ignition - No smoking.
S26	In case of contact with eyes, rinse immediately with plenty of water and seek medical advice.
S29/56	Do not empty into drains, dispose of this material and its container at hazardous or special waste collection point.
S36/37/39	Wear suitable protective clothing, gloves and eye/face protection.
S46	If swallowed, seek medical advice immediately and show this container or label.
S51	Use only in well-ventilated areas.
S61	Avoid release to the environment. Refer to special instructions/safety data sheets.
P14	Contains ROSIN. May produce an allergic reaction.

BOSTIK NE486

STATUTORY INSTRUMENTS

Chemicals (Hazard Information and Packaging) Regulations. Control of Substances Hazardous to Health.

APPROVED CODE OF PRACTICE

Classification and Labelling of Substances and Preparations Dangerous for Supply.

GUIDANCE NOTES

CHIP for everyone HSG(108). Workplace Exposure Limits EH40.

16 OTHER INFORMATION

GENERAL INFORMATION

This product should be used as directed by Bostik Ltd. For further information consult the product data sheet or contact Technical Services.

INFORMATION SOURCES

This safety data sheet was compiled using current safety information supplied by distributor of raw materials.

REVISION COMMENTS

This safety data sheet supersedes all previous issues and users are cautioned to ensure that it is current. Destroy all previous data sheets and if in doubt contact Bostik Limited.

ISSUED BY

Approved LJ

REVISION DATE 18/03/2008

REV. NO./REPL. SDS GENERATED 11

DATE Feb 2003

RISK PHRASES IN FULL

R11	Highly flammable.
R12	Extremely flammable.
R22	Harmful if swallowed.
R34	Causes burns.
R36	Irritating to eyes.
R38	Irritating to skin.
R42/43	May cause sensitisation by inhalation and skin contact.
R43	May cause sensitisation by skin contact.
R48/20	Harmful: danger of serious damage to health by prolonged exposure through inhalation.
R50/53	Very toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment.
R51/53	Toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment.
R52/53	Harmful to aquatic organisms, may cause long-term adverse effects in the aquatic environment.
R62	Possible risk of impaired fertility.
R63	Possible risk of harm to the unborn child.
R65	Harmful: may cause lung damage if swallowed.
R66	Repeated exposure may cause skin dryness or cracking.
R67	Vapours may cause drowsiness and dizziness.